



# Better Pumps. Better Coverage.

## Improved Connector and Pigtail for GM Fuel Pump Modules Technical Service Bulletin

### The Problem:

Many GM vehicles from 1988 to 2005 have electrical connectors on the fuel pump module that may become loose over time due to vibration, leading to faulty, high-resistance connections. The symptoms – burned or melted connectors and pins – lead to a voltage drop situation where low or no voltage can cause the module to stop pumping.



**Old Vehicle Harness  
Sold Separately**

### The Solution:

Airtex's latest fuel system solution provides a quick and reliable fix for burned or melted wiring harness connections on certain GM in-tank fuel pump applications. The faulty OEM design connector has been replaced with a new OEM design that eliminates the burned or melted connectors and pins problem.



**New Vehicle Harness  
Included with Fuel Pump  
Modules**

**Airtex fuel pump modules with the improved 4-pin connector require vehicle harness replacement. One of the five application-specific, color-coded vehicle wiring harnesses is included with every pump that uses the new connector.**





# Better Pumps. Better Coverage.

## Improved Connector and Pigtail for GM Fuel Pump Modules Technical Service Bulletin


E3372M, E3500M, E3501M, E3506M, E3508M, E3509M, E3511M, E3518M, E3533M, E3535M, E3536M, E3537M, E3538M, E3542M, E3543M, E3563M, E3920M, E3923M, E3925M, E3927M, E3928M, E3929M, E3939M, E3940M, E3941M, E3943M, E3947M, E3952M, E3953M, E3954M, E3956M, E3957M, E3962M, E3963M, E3965M, E3966M, E3967M, E3968M, E3969M, E3971M, E3972M, E3973M, E3974M, E3979M, E3982M, E3992M, E3994M, E8397M

\*Consult the Airtex Fuel Pumps online catalog for specific vehicle applications.

New wiring harness included.  
Refer to enclosed installation instructions.


**Modules with Improved Connector and Included Wiring Harness Have this Decal on the Package End-Flap.**

### Old Design—Top & Side View

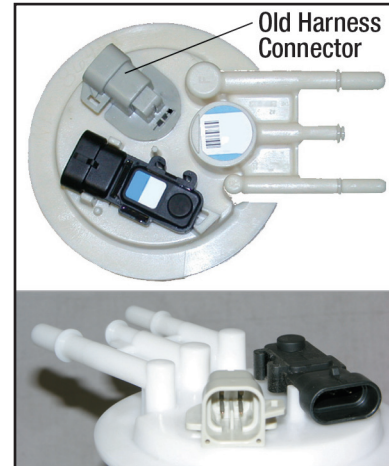

**GM Fuel Pump Module with Old Harness Connector**

### New Design—Top & Side View

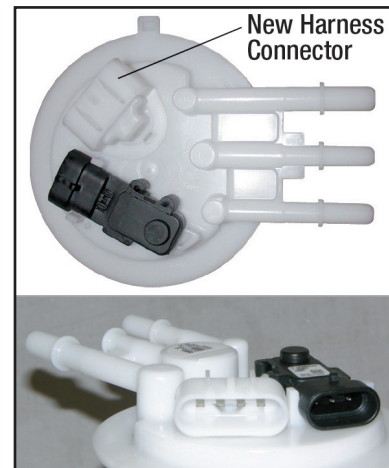

**GM Fuel Pump Module with New Harness Connector**

